# **Product sheet** Miniature connector




Product

Pole

Contacts: 8 DIN, Female cable connector with shielding ring, shieldable, cable outlet 8 - 10 mm, with UL approval 8 DIN

Area Article number M16 IP67 Series 423 99 5872 15 08

# Illustration

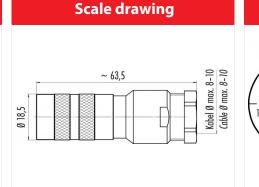

### **Contact Arrangement**

Х

γ

0,00


3,50

0,00


2,47

2,47

-2,47

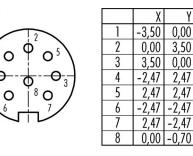

**Attenuation characteristic** 

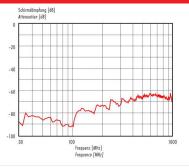

You can find the item description and assembly instruction on the next page.

# **Technical data**

# **Common values**

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature

Female cable connector screw Solder 0.75 mm<sup>2</sup> 20 8 - 10 mm 95 °C -40 °C

# **Electrical values**

Rated voltage Rated impulse voltage Pollution degree Overvoltage category Material group Rated current (40°C) Volume resistivity EMV compliance Degree of protection Mechanical operation

# **Material**

Material of contact Contact plating Material of contact body Material of housing

60 V 500 V 1 L Ш 5 A  $\leq 5 \text{ m}\Omega$ shielded IP67 > 500 mating cycles

CuSn (Bronze) Ag (Silver) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 8, Female cable connector with shielding ring, shieldable, cable outlet 8-10 mm, silver plated contacts, with UL approval



# Product sheet Miniature connector




Product

Pole

Contacts: 8 DIN, Female cable connector with shielding ring, shieldable, cable outlet 8 - 10 mm, with UL approval 8 DIN

Area Article number M16 IP67 Series 423 99 5872 15 08

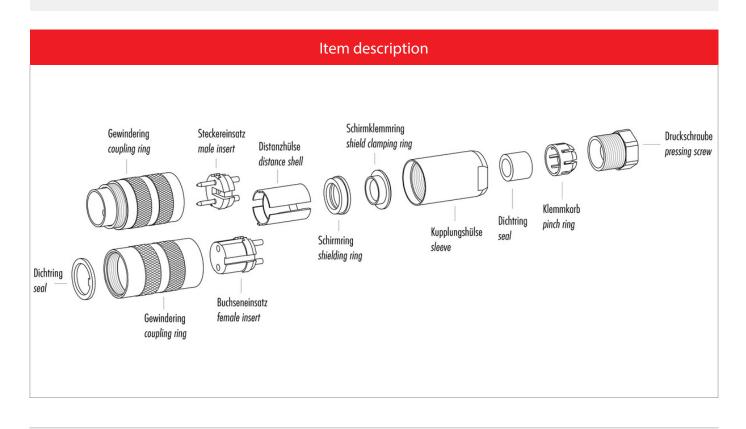

# Installation instructions / Mounting cutout

### **Gerade Version**

### (Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

### Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

